```
_+_____
     Bosch Motorsport
     MSA-Box LX: USB-CAN-KLine device
     MSA-Box 2: USB-CAN-KLine-Ethernet device
     Version History
_+_____
______
V1.07 - 20070424
 - fixed OBD-disconnect/connect problem (on HW with DC/DC removed)
- use USB-SYS-driver version V1.0.5.9 (allows standby + hibernation)
- firmware
  - CAN: filter repaired
  - CAN: 10kbps is not possible
  - CAN: BusOFF Recovery is working
 - communication DLL
  - improved DriverOpen
- known bugs
  - Firmware is crashing after/while standby + hibernation.
V1.08 - 20070702
 - firmware
  - KLine: added KLine B Protocol implementation
  - changed interrupt priorities to avoid missing data on high KLine
speed
    moved priority of USB interrupt below UART and Timer interrupt
- known bugs
  - Sometimes PnP doesn't work when starting with plugged LiteXS
  - 313kbps needs fractal-baudrate-generator setup in the firmware
_____
V1.09 - 20070712
 - firmware
  - KLine: use fractal-baudrate-generator (enable correct 313kbps)
V1.10 - 20070727
- installer
  - display firmware version in windows software list
  - deinstall a previously installed version
V1.11 - 20070908
 - communication DLL
  - improved device disconnect handling (fast driver close ca. 100ms)
- installer
  - added History.txt
  - use new picture
```

```
V1.12 - 20071218
 - communication DLL
   - changed handling during USB polling
        (tester CPU is released anyway in read cycles)
    - reduce CPU usage (ca. 20 - 30% less) during USB read cycles
    - but also less performance
______
V1.13 - 20080618
 - fixed CAN timestamp problem
 - fixed error in manual CAN BTR setting
 - communication DLL: faster stopp of RxThread -> faster unload of driver
 - KLineB
   - disabled single byte transfer to PC except when buffer overflow
   - enlarged buffer limit on firmare to a multiple of 80 ==> 80*13 =
1040
V.20 pre
 20090120 - added ethernet driver to installer
 20090121
  - added support for MSA Box 2
  - don't send serial of device as part of USB-id string
  - enlarged size for productname in USB comm. from 9 to 10
  - increased versions: levelx 1.14; bootloader 1.9
V1.15
b) 20090420
    - dismiss version conecept 2.0 - return to 1.15
      - handle TX before RX in CAN ISR to ensure log TX request before
answer
      - fixed error of permuted bytes for quantity in UploadRequ
      - added Quantity attribute to DownloadRequ and UploadDataInd
      - accept 8 byte CAN Data reply for X (<8) bytes UploadRequest
        (Error 0x4 is now only send when rx 0 bytes)
 c) 20090826
    - added functionality to check KLine power supply for MSABOX II
      - added error codes for: KLineL2 5BaudInit, Tx, TxBlock,
TxBlockWithIntertime
        - 11: no external power
        - 12: short circuit
      - added short circuit indication message (0x04,0x04,0x30,0)
      - added 3. timer
 d) 20090909 - bugfix: reset UART after leaving KLine-Short-Circuit
```

V1.16 20090909

- version number has changed in order to become an official release

V1.17 20100309 a) 20091112 - bugfix: debounced KLine short circuit detection to 300 ms - use new version (3.4.3.35) of AX88772 driver b) 20091203 - include AX88772 driver for Windows Vista and Windows 7 (32bit) 20091218 - bugfix AX88772 driver installation for Windows 7 c) 20091218 - bugfix AX88772 driver installation for Windows Vista d) 20100301 - don't use USB driver as shared DLL anymore - remove USB driver during every deinstallation - remove also the msd-directory during deinstallation
v2.00 20100811 - Support for following operating systems Windows XP SP3 32bit Windows XP SP3 64bit Windows Vista 32bit Windows Vista 64bit Windows 7 32bit Windows 7 64bit - All drivers are digitally signed with Microsoft Authenticode
v2.01 20101118 - Update AX88772A driver for all supported operating systems this update shall fix some BSoD caused by asix drivers
v2.02 20110415 - LevelX DLL driver close handling fixed